Defra research into Internal Erosion

A. J. BROWN, Jacobs, Leatherhead, UK J. D. GOSDEN, Jacobs, Croydon, UK

SYNOPSIS. This paper summarises the background to, and the key findings and conclusions from, two Defra research projects on internal erosion. It then discuses the practical implications for dam owners and panel engineers in terms of monitoring and surveillance. The paper concludes with a discussion on current uncertainties on rates of progression of internal erosion, and what future work would be useful to reduce these.

INTRODUCTION

Internal erosion occurs when the soil particles within an embankment dam or its foundation are carried downstream by seepage flow. Available data on reservoir safety incidents in the United Kingdom in the period 1975-2000 are summarised in Table 1. It can be seen that over half of the incidents where emergency drawdown is considered necessary to avert failure have been a result of actual or anticipated internal erosion. Experience internationally is similar, with ICOLD Bulletin No 99 (ICOLD, 1995) noting that 44% of dam failures internationally are due to internal erosion.

Despite the, on average, two emergency drawdown incidents a year due to internal erosion in UK there have been no failures of dams with loss of life due to internal erosion since the Reservoirs (Safety Provisions) Act was implemented in 1930. It is suggested that a significant contributor to this absence of failures includes the effective surveillance and intervention regime, which has provided time to detect developing problems and lower the reservoir before the problem developed to failure. However, the continued pressure for reduction in costs, and thus reducing frequency of surveillance, together with the increasing average age of UK dams, is likely to lead to increasing risk of dam failure from internal erosion.

Following a serious internal erosion incident in January 2002 (Gardiner et al, 2004) a Defra research contract into early detection of internal erosion was awarded to KBR in 2002. The first phase, a feasibility study, was completed in 2004, with the research report available on the Defra website

and reported in Brown and Gosden (2004). Funding difficulties meant that the second stage of the contract, measurement of erodibility of UK soils, was cancelled. The contract was therefore completed (after novation to Jacobs) by production of draft guidance on early detection of internal erosion, and a study into the practicability of real time monitoring. This paper summarises the key points from these projects, as an update on the 2004 paper in Dams and Reservoirs (Brown and Gosden, 2004).

Table 1: Data on internal erosion incidents in the United Kingdom in the period 1975-2000

Level of incident	2: Emergency	3: Precautionary		
	drawdown	drawdown		
Average number of incidents per year	3	10		
(Brown and Gosden, 2004)				
% of UK incidents due to varying causes				
(Table 6 of Brown and Tedd, 2003)				
• internal erosion	60%	63%		
• slope instability	23%	9%		
Inferred annual probability of an incident due	1 in 500	1 in 160		
to internal erosion, for 2500 UK dams (0.2%) (0.6%)				
Note: The annual probability of failure at le	ss than 1 in 50,0	000 is much lowe		
because most incidents do not progress to failu	re			

FRAMEWORK FOR CONSIDERING INTERNAL EROSION

The framework for assessing the likelihood of each of these types of internal erosion is described in a companion paper on the European Working Group on Internal Erosion (Brown and Bridle, 2008) and is not repeated here. This paper focuses instead on the rate of development of internal erosion, and means to detect and manage this.

RATE OF INTERNAL EROSION - EXPERIENCE

Key elements of historic internal erosion incidents which have been recorded in published papers are summarised in Tables 2 and 3. It can be seen that although incidents during the first few years following construction are generally rapid, incidents at dams more than five years old generally develop much more slowly.

A questionnaire to dam owners on the likely time to failure, if no action was taken, was presented as Figure 3 in the 2004 paper and confirmed the wide variation in time to failure, but also that the rate of development in UK dams is generally modest within the body of the dam but much faster when associated with internal erosion along the contact with a structure.

Tabl	e 2: R	ate o	of o	deve	elop	oment	t of	internal	erosion	incidents	at	embar	ıkment
dams	S												
D	D (C		• 1	1 1	• •			C 1	1 .	1.		c .

Dam, Date of	Available information on rate of development, and type of						
Incident	internal erosion (Reference)						
During wear in	During wear in period						
Warmwithins,	The dam is a 10m high puddle clay core dam built in the 1860s.						
UK	It failed over a period of 12 hours, along a new 1.5m diameter						
June 1970	tunnel lined with concrete segments installed about 1965.						
	(Wickham, 1992)						
Balderhead,	On first impounding the first sinkhole was above the filters on						
1970	the downstream side of the core, followed six weeks later by						
	large holes on the upstream side of the core. The underdrain						
	water had also become turbid. (Kennard, 1972)						
Teton, USA	The dam failed over a period of 2.5 hours. The dam core was						
June 1976	built of wind deposited non-plastic to slightly plastic clayey silts,						
	and founded on moderately to intensely jointed volcanic rocks.						
	The time stated is from the first muddy flow being seen to the						
	first whirlpool being seen in the reservoir. Concentrated leak?						
	(Report into failure of Teton dam)						
In service							
Upper	New concentrated leak into culvert. Emergency drawdown such						
Rivington	that the reservoir ceased to overflow 48 hours after being						
Jan 2002	detected, and was 7m below top water level six days after ceasing						
	to overflow. (Gardiner et al, 2004)						
Scandinavian	35 cases of sinkholes and sudden leakage due to suffosion,						
dams	generally after many years in service. These usually seal						
	themselves after a short time. Settlements, sinkholes and leakage						
	have often occurred at the junction between an embankment dam						
	and a concrete structure. (Nilsson, 2007)						

Table 3: Examples of slow ongoing internal erosion in UK dams

Dam	Inferred erosion rate (Reference)
Brent	1.0 litre/ year measured in V notch chamber (Tedd et al, 1998)
Anonymous	1.0 kg/year measured in V notch chamber (private communication
-	from dam owner, 2007)
Lower Slade	3ft diameter swallow hole exposed when upstream pitching lifted. 60
	tons of grout injected into open holes into 70 year old dam, where
	repairs had been carried out 15 years before. Say 1 ton/ year
	(Kennard, 1972)
Lluest Wen	A horse fell into a hole near the valve tower at Christmas 1969.
	Emergency declared with evacuation of old and infirm downstream,
	50 ton of clay/ cement grout injected into watertight element, which
	had been previously treated in 1912. Approx 1 ton/year. (Little,
	1977)

RATE OF INTERNAL EROSION – PREDICTION AND RISK ASSESSMENT

It is suggested that the level of detail which is appropriate to apply to the assessment of vulnerability to rapid internal erosion should be on a risk based approach. This considers whether the Undertaker has reduced risk to as low as reasonably practicable (ALARP), namely whether the measures taken have been proportionate to the reduction in risk that could be achieved. The ALARP decision making process is defined in paragraph 124 and Appendix 3 of "Reducing risks, protecting people" (HSE, 2001) with further guidance given at <u>www.hse.gov.uk/risk/theory/alarp.htm</u>. The Interim Guide to Quantitative Risk Assessment (Brown & Gosden, 2004) provides a screening level of risk assessment, which can be a useful first step.

The process to assess the vulnerability of a dam to internal erosion is described in Brown & Bridle (2008), and requires data on the geometric, geological, geotechnical and hydraulic properties of a dam. The vulnerability to rapid failure is an extension of this, but also considers the likely rate of failure. This is likely to vary depending on the erodibility of the soil and type of internal erosion, the latter as indicated in Table 4.

Although in theory analytical predictions of the rate of development of internal erosion at concentrated leaks are now possible, currently this analysis is not common in UK. Nevertheless assessments carried out as part of the research contract comprised a sensitivity study of flow and erosion in a 1m high 3m long crack under 10m head which showed that

- a) the rate of erosion varied between 0.1 and 1000kg/ day, depending on the erodibility of the soil (Figure 6 of Brown and Gosden (2004); erodibility as defined by Wan and Fell, 2004)
- b) Turbidity of less than about 5FTU is not visible to the human eye; so for this combination of crack width and reservoir head, material eroded from a soil with a value of Erosion Rate Index of between 4 and 6 would not be visually detectable

In terms of risk assessment the rate of development can be categorised in terms of the ability to manage the incident and prevent dam failure, and a suggested categorisation is given in Table 5, together with the implications for bottom outlet capacity.

Туре	Definition	Likely time to failure; remarks
Concentrated	In soils which are capable of	The rate of erosion is
erosion	sustaining an open crack.	dependant on the erosion
	Erosion occurs along the sides	resistance of the clay core, and
	of the crack where the shear	may be limited by the
	stress (velocity) exceeds the	permeability of both shoulders.
	critical value.	Where cracks exist in the dam
	NB at low flows there may be	crest (e.g. desiccation,
	leakage with no erosion.	differential settlement) then the
		critical failure mode may be
		concentrated erosion during flood conditions
Backward	Erosion starts at the exit point; a	Can be fast with little warning.
Erosion	continuous passage is	Failure is often associated with
(Piping)	developed by backward erosion	first filling, or an increase in
(Tiping)	when the seepage gradient	seepage gradient (for example
	exceeds the "flotation gradient"	under flood conditions)
	of the soil.	,
Contact	Erosion at the horizontal	Little information. Likely to be
Erosion	boundary of a fine soil	similar to concentrated erosion,
	overlying a coarse soil, where	but accelerated where along the
	the fine soil is washed into the	interface between a structure
	coarse soil due to horizontal	and the embankment
	flow	
Suffosion	Mass erosion in soils which are	Normally leads to an increasing
	internally unstable. Fines	quantity of seepage as fines
	transported by seepage flow	erode, but is unlikely to lead to
	between the larger sizes of soil	rapid failure

 Table 4: Types of internal erosion (after European Working Group)

		C I	0.0.11	1 .	• . •	•
- Table N. Suggested	categorication	of cneed	l of tailure	due to	v internal	erocion
Table 5: Suggested	categorisation	or spece	i or ranuic	uuc n	<i>i</i> mucinai	CIUSIUII

Smood of	Time to	Deletion to Sumueillence	Value of bottom outlet for
Speed of	Time to	Relation to Surveillance	Value of bottom outlet for
failure	failure	frequency	emergency drawdown
Extremely	< 1 day	Unlikely to be spotted	Irrelevant
fast	-	• •	
Fast	1 to 7 days	Where there are frequent	Dependent on the
	-	visits >50% chance of	frequency of surveillance
		being spotted while there	visits, and thus the
		is still time to avert failure	residual time available for
		is still time to avert failure	
			intervention
Medium	8 to 90	Good chance of being	Likely to be of most value
	days	spotted, provided frequent	
	2	visits are made	
Slow	> 90 days	Almost certain to be	Magnitude of ongoing
	•	spotted provided there are	inflows likely to be the
		routine surveillance visits.	largest influence on the
			size of the bottom outlet
			size of the cottom outlet

SURVEILLANCE AND MONITORING

Once an understanding of the risk from internal erosion has been obtained as described above, the type and frequency of the surveillance and monitoring regime can be determined. It would normally include visual inspection as a minimum, and monitoring on higher consequence dams. Current international practice for the frequency of surveillance visits is generally based on the consequence class of the dam, for example on high hazard dams typically being weekly although ANCOLD guidelines (Table 5.2 of 2003) suggest it should be daily. For low consequence dams a typical frequency is monthly.

It is suggested that it would be more rational if the frequency of surveillance were risk based, in that as well as consequence class it also took account of the probability of (vulnerability to) rapid internal erosion. A suggested risk matrix to determine a surveillance and monitoring regime is given in Table 6, whilst a possible starting point for defining the surveillance frequency of dams in service is given in Table 7. The latter is developed from ANCOLD Guidelines on Dam Safety Management (2003). Both are suggested starting points for application and adjustment on a dam specific basis, following the principle that the cost should be proportionate to the benefits obtained.

a ualli					
Vulnerability to internal erosion ¹ , Consequence Class of dam					
as output from risk analysis	(as define	d in Interin	n Guide to	QRA, 20)04)
	A1	A2	В	С	D
High	α	β	β	γ	δ
Medium	β	β	γ	δ	ε
Low	γ	γ	δ	3	3

Table 6: Indicative risk matrix for the surveillance and monitoring regime at a dam

Notes

1. Ranking on the vertical axis could be on the basis of one of the following

• The tolerability of risk, comprising the Broadly acceptable, ALARP and Unacceptable zones on the FN chart (Sheet 11.3 of Interim Guide to QRA)

• Likelihood of failure, as a qualitative assessment

• Speed of failure, as defined in Table 5, with Fast and extremely fast considered together

Regime (Table 6)	α	β	γ	δ	8
Routine visual surveillance					
Exterior; including exterior of culverts/ shafts (and interior where no confined	Daily to 48 hours	48 hours to twice	Twice weekly to fortnightly	0.5 to 2 months	Two to six months
space)		weekly	Torunghuy		montifis
Interior of culverts/ shafts,	Weekly	Monthly	3-Monthly	Five	Ten
where confined space ²	to	to 3-	to annual	yearly	yearly
	monthly	monthly			
Number of visits a year by Supervising Engineer ³	4	3	2	1	1

Table 7: Indicative surveillance frequency for dams in service

Notes

- 1. The timing should be calendar time, and thus occur at weekends and bank holidays where these fall in the routine cycle.
- 2. The timing can be reduced by say up to two classes, where any progressive internal erosion would be visible by inspection at the downstream end
- 3. Where the dam owner does not have suitable trained and experienced employees then the frequency of Supervising Engineer visits would normally be increased, and they should include an element of training of the dam owner and his staff

REAL TIME MONITORING

Introduction

One of the Defra research contracts was a review of current practice in real time monitoring, both in relation to dams and other industries, leading to production of a Guidance Note. This section summarizes some of the key findings from this review.

When could this be appropriate for UK dams?

Real time monitoring may be appropriate at high consequence dams where it is considered there is a possibility of rapid development of internal erosion, if it initiated. It is emphasised that this should not be a substitute for visual inspection, as visual inspection covers the whole of the dam structure, whereas monitoring only covers the element or part of the structure where the sensors are installed.

Current practice

ICOLD Bulletin 118 (2000) provides case histories and guidance on automated monitoring at dams internationally. In UK real time monitoring of sensors is now standard practice in the water industry as part of the demanning to reduce operational costs. It is also sometimes necessary to demonstrate compliance with discharge consents or other statutory requirements.

In the UK, British Waterways undertakes real time monitoring of key assets for operational purposes, including some dams, using a system developed in-house. Parameters monitored relate mainly to operational issues of water levels, weir operation, flows at gauging weirs, sluice operations and gate positions. Alarms are incorporated where appropriate, with relevant personnel being notified directly by mobile telephone or pager if a trigger level is reached. A 'reach out' facility, in which remote operation can be undertaken, for example of drawoff sluices, is also available at a limited number of sites. At a few sites the sluice operation is automatic based on reservoir water levels, with various fail-safes included in the system.

The real time monitoring system is internet based and has been in operation since 2004. All software has been developed in-house. In general, remote readings are recorded at 30 second intervals, being averaged to provide a reading over 5-minute intervals. Where mains power is not available, the power source is commonly solar cells and batteries. In order to conserve batteries, stored information is only transmitted to the central server every 24 hours, although the stations can be polled at any time in-between if required. 90% of the information is relayed by mobile telephone technology, with the remaining 10% being transmitted by land line. Data from the last ten years, including information obtained both manually and remotely, can be retrieved upon request. There are no limits to the number of persons who can access the database at any one time. Problems associated with the system include the susceptibility to vandal damage and the rapid rate at which current technology becomes obsolete.

In relation to reservoir safety water levels are recorded automatically at some reservoirs, although water levels noted manually at the remaining reservoirs are also entered into the database. Manually read v-notch, piezometer and flows measured using jugs will soon be entered into the same database. The information can readily be extracted from the database live through the internet, and presented in graphical format which is considered better than Excel format. In summer 2009 SCADA monitored V-notches will be monitored at a remote reservoir with a history of seepage above a small town; the V-notches will have trigger flows set, which will raise an alarm.

A number of UK water companies have each installed real time monitoring of seepage at V notch weirs at one or two dams, generally because of specific issues at those dams. In Canada it is now routine practice by BC Hydro to have real time monitoring of flows and turbidity at the seepage weirs at all of their dams.

Parameters

The parameters which are most useful to provide early warning of internal erosion are seepage flows and turbidity. It is noted that suspended fines in seepage water cannot be seen visually where Formazine Turbidity Unit (FTU) is less than 5, and thus would only be detected by quantitative monitoring. For clay fines an approximate conversion is 2.5mg/l per FTU, such that seepage of 5 litres/ min with a FTU of 5 could correspond to solids of 90g/day

Procurement and maintenance

The practicality, cost and reliability of real time monitoring is significantly dependent on resources available within the Undertaker's organisation to install and maintain any system. Table 8 contrasts current practice at a water treatment works and at British Waterways. As a budget figure the cost of real time monitoring of a simple V notch chamber is likely to be of the order of installation cost of £20k for the civils works and monitoring equipment; an annual maintenance cost of £1k/ year; and £5k every ten years for replacement of sensors and other monitoring equipment. This cost is thus likely to only be proportionate at high consequence dams, where it provides a significant reduction in the probability of failure.

Issue	Water Company – Real time	British Waterways
	monitoring installed at water	j~
	treatment works	
Equipment installation	In-house staff	External contractor
Maintenance cleaning:	Twice a week by plant	All carried out by
frequency and by	engineers who visit each	external contractor six
whom	WTW regularly	monthly, and under
ICA check i.e. check	By instrument technician (the	call-out where problem
that it still works	company employs 50 specialist	identified
correctly	ICA staff)	
Recalibration	Periodically; often in the	
	laboratory at the WTW	
Instrument	On failure, or when technology	Ten years
replacement	superseded	
Replacement of	Not relevant	Routinely as part of six
batteries in power		monthly check
pack		
Alarm sent to	24 hour control centre, manned	Mobile phone of Duty
	by in-house staff	Engineer
24 hour control centre		Contracted out to First
for receipt of alarms		Response (West
from public		Midlands Ambulance
		Service)

Table 8 Range in variation in strategy for real time equipment

Use of data

A key element of assessing the practicality and value of real time monitoring is the use and archiving of the data collected. This will depend on the software used and management of alarms. For water companies and other major owners with control rooms which are manned on a 24/7 basis real time monitoring should be a viable option, although some development work would be required to integrate it with other existing real time systems. For owners who do not have this resource then the system could be developed to provide a SMS text or other form of automatic alarms, but this is likely to be less reliable.

FUTURE RESEARCH

The research projects identified that there is still much work to be done to bring our understanding of internal erosion to the same level as our understanding of other threats to dam safety, such as hydrological assessment. Issues identified for future research are summarised in Table 9.

Table 9: Priorities for future research relating to internal erosion

Description

Laboratory testing of threshold, and rate of internal erosion, of sides of pathway through core, similar to that in Australia. This would be an extension of the pinhole test (BS1377:part 5: 1990 Section 6.2); including changes such that a 6mm hole is used instead of a 1mm hole, and the rate of erosion is measured

- Collection and analysis of data on incidents, specifically
- a) Lessons learnt reports from incidents
- b) Data collected as part of the database, to allow statistical analysis, on the range of geotechnical properties of UK dams relevant to internal erosion
- c) Data on the annual probabilities of an incident, and dam failure respectively, both inferred from incidents and estimates in published papers

Materials present in UK dams

- a) Desk study of existing site investigation reports on SI carried out in the past, and (relevant) published data on geological strata
- b) Field investigation with associated laboratory testing of core and shoulder to better understand the range of properties for typical UK dams; followed by identification and analysis of the credible failure mechanisms for the system of dam core and supporting shoulders
- c) Field investigation of construction details of pipes and culverts through dams, where the dams have been discontinued

CONCLUSIONS

The overall objective for the research project was to "provide a costeffective approach to the early detection of progressive internal erosion in embankment dams". Although there is no simple single tool which can achieve this objective, the research project and other ongoing parallel research in Europe and elsewhere have led to an increased understanding of the vulnerability to, and potential rate of development of, internal erosion. This has highlighted

- The large variability in erodibility of materials used to form the watertight element of dams
- That internal erosion can occur at a slow rate for many years with no apparent surface effect, and with suspended particles in concentrations too low to be detected visually
- The rate of development is likely to vary significantly depending on the type of internal erosion
- The increased likelihood of internal erosion along the contact with structures, relative to internal erosion in the body of the dam

Site specific engineering assessment to inform an assessment of the vulnerability to internal erosion should include

- a) The consequences of the failure of the dam, in terms of impact on people and property downstream, and thus what measures would be proportionate to reduce the likelihood of failure to as low as reasonably practicable
- b) Determination of the erodibility of the material(s) used to form the watertight barrier
- c) An understanding of the system response, as to how the dam shoulders or other elements may affect internal erosion of the watertight element

Suggestions have been made of normal surveillance type and frequency, following a risk based approach. Real time monitoring has been reviewed in relation to current practice, potential costs and issues relating to data and alarm management.

ACKNOWLEDGMENTS

We acknowledge the contribution to this project from British Waterways and a number of water companies who provided valuable assistance in making information and staff available, and also to the European Working Group on Internal Erosion, chaired by Jean Jacques Fry of EDF. We also gratefully acknowledge the time spent by panel engineers and other dam professionals in completing questionnaires at the start of the project.

The project benefited from a Steering Group to advise Defra which comprised at Stage 1, the draft strategy for management of internal erosion, Jim Millmore (chair), David Dutton, Nick Reilly and Andrew Robertshaw.

The work described in this paper was carried out as a research contract for Defra. However, the opinions expressed are solely those of the authors and do not necessarily reflect those of Defra or other who contributed to the project.

REFERENCES

ANCOLD (2003) ANCOLD Guidelines on Dam Safety Management

- Brown AJ and Gosden JD (2004a) The early Detection of Internal Erosion. *Dams and Reservoirs* 14(1) pp13-20
- Brown, A.J. and Gosden, J.D (2004b) Interim Guide to Quantitative Risk Assessment for UK Reservoirs. Thomas Telford.
- Brown and Bridle (2008) Progress in assessing Internal Erosion. BDS Conference
- Gardiner K, Hughes, Brown AJ (2004) Lessons from an incident at Upper Rivington reservoir. *Dams and Reservoirs*. September. Pp35-37
- HSE (2001) *Reducing risks, protecting people. HSE's decision making process.* On website <u>www.hse.gov.uk/</u>
- ICOLD (2000) Bulletin 118 Automatic dam monitoring systems
- KBR (2004) *Reservoir safety research contract for Defra. Task B : Early detection of internal erosion.* Feasibility Report. On Defra website.
- Kennard (1972) Examples of the internal condition of some old earth dams. *Journal of the Inst. of Water Engineers*, v 26, n 3, May, 1972, p 135-154
- Little (1977) Investigating old dams. *Quarterly Journal Eng. Geol.* Vol 10. p271-280
- Nilsson (2007) *Filters and internal erosion in Swedish dams*. Paper from workshop at Aussois. Published by Taylor & Francis
- Tedd P, Dutton DPM, Horton IR (1998) *Investigating internal erosion at Brent Dam.* Proc BDS Conf. pp71-78
- Wan CF and Fell R (2004) Investigation of rate of erosion of soils in embankment dams ASCE Geotech April pp 373-380
- Wickham (1992) Collapse of an earth embankment dam. *Dams and Reservoirs*. October 2(3) pp18-19